

'ТМ

HUBER+SUHNER® SUCOTEST 18 ASSEMBLY

Part no.: Order no.: ST-18/Nm/Nm/48 84003372

Electrical specifications

Impedance Operating frequency Velocity of propagation Capacitance Time delay Insulation resistance Dielectric withstand voltage Screening effectiveness

50 Ohms 18 GHz 77% 87 pF/m (26.5 pF/ft) 4.3 ns/m (1.31 ns/ft) $> 5 \times 10^{3} M\Omega$ 2'500 V rms > 90 dB

General specifications

Assembly length Cable diameter Temperature range Preferred bending radius Connector retention force Recommended mating torque 0.68 Nm... 1.13 Nm

Connector interface Weight

Dimension

1219 mm (48 in.) 4.6 mm (0.181 in.) -55°C to +105°C 100 mm (4.0 in.) > 200 N (6.0 ... 10.0 in.lbs) MIL-STD-348A/304 122 gram


Materials and finishes

SUCOTE:

precise.

Cable iacket Cable dielectric Taper sleeves Marking sleeve Connector contacts Connector insulation Connector body Connector nut Gasket

FEP, blue LDPTFE Santoprene / black Crosslinked polyolefin/white Beryllium-copper, gold plated PTFÉ Stainless steel, passivated Stainless steel, passivated Silicon rubber

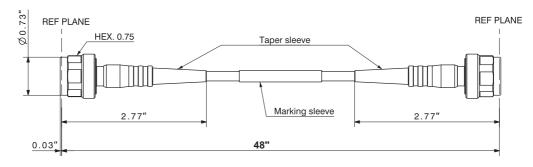

dimensions in inch

Electrical table

		up to 2 GHz	2.01 to 4 GHz	4.01 to 6 GHz	6.01 to 12 GHz	12.01 to 18 GHz
Min. return loss	(dB)	30	28	25	21	19
Max. insertion loss at 25°C	(dB)	< 0.61	< 0.88	< 1.09	< 1.57	< 1.95
Max. cw power at 25°C, sea level	(W)	> 391	> 277	> 225	> 160	> 131
Max. insertion loss vs. shaking	(dB)	< 0.03	< 0.03	< 0.03	< 0.03	< 0.03
Max. insertion loss vs. bending	(dB)	< 0.03	< 0.04	< 0.04	< 0.05	< 0.05
Max. insertion loss vs. torsion	(dB)	< 0.03	< 0.04	< 0.04	< 0.05	< 0.05

Excellence in connectivity solutions

Care and handling instructions for HUBER + SUHNER microwave cables

HUBER + SUHNER microwave cable assemblies of all types offer a long service life providing they are treated with the appropriate care and attention. Microwave cable assemblies are high precision system components and require proper handling in order to ensure that measuring performance values are maintained.

To achieve the maximum measuring performance the following guidelines should be followed:

1. Assemblies should remain in their original packaging for delivery and storage. Storage temperature should be between -50 °C and +80 °C and the relative humidity should not exceed 85%.

2. Carefully unpack assemblies before measurement. Avoid kinking cables when straightening from a coil or reel.

3. Ensure that the surroundings are clean and free of dust, dirt and any other particles that could enter unsealed connector interfaces.

4. Use protective caps to prevent contamination whenever connectors are unmated.

5. Where interfaces are contaminated, particles can be removed with dry, oil-free compressed air. Please use eye-protection. Interfaces can be cleaned with dry cotton swabs. Do not use hard hand-tools or solvents. Do not blow into interfaces or use normal compressed-air. 6. Choose the measurement routing using the largest bend radii possible. Small bend radii may affect electrical performance. Exceeding the specified limits during the measurement process could cause a permanent degradation.

7. Avoid twisting microwave cable assemblies. Torsion of this type of assembly can alter the relative diameters of cable layers and affects the electrical characteristics. Exceeding the limit of 10° per metre during measuring process could cause a permanent degradation.

8. Examine interfaces for damage and/or contamination before mating.

9. Discharge connectors before mating or ensure that they are connected to a suitable ground.

10. When mating connectors with a screwed interface always hold the connector bodies and turn only the coupling nut. This avoids twisting the cable and ensures minimum wear on the connector pins.

11. Do not exceed the torque specified.

The HUBER+SUHNER is certified according to ISO 9001 and ISO 14001.

WAIVER

While the information contained in this folder has been carefully compiled to the best of our present knowledge, it is not intended as representation or warranty of any kind on our part regarding the suitability of the products concerned for any particular use or purpose and neither shall any statement contained herein be construed as a recommendation to infringe any industrial property rights or as a license to use any such rights. The suitability of each product for any particular purpose must be checked beforehand with our specialists.



www.hubersuhner.com